Loading and Unloading Data from CoCo
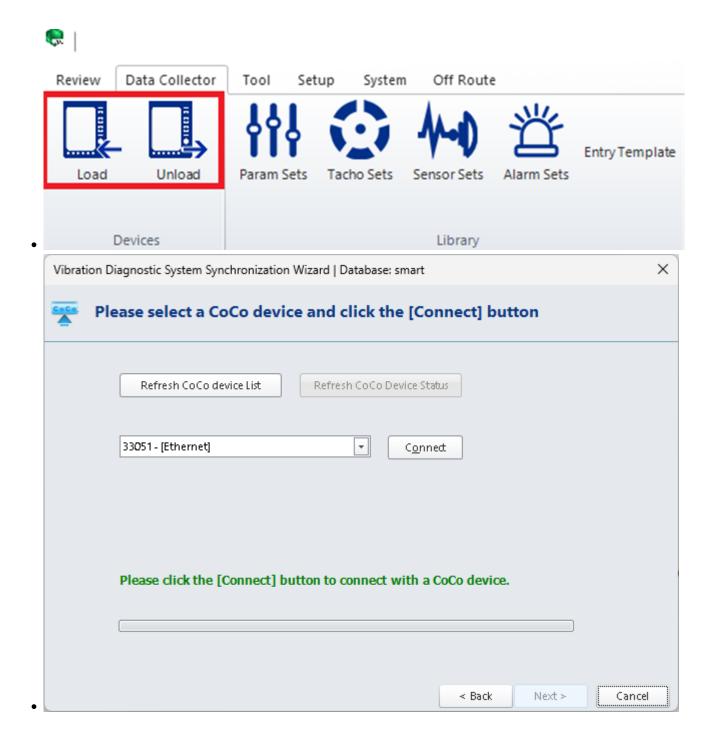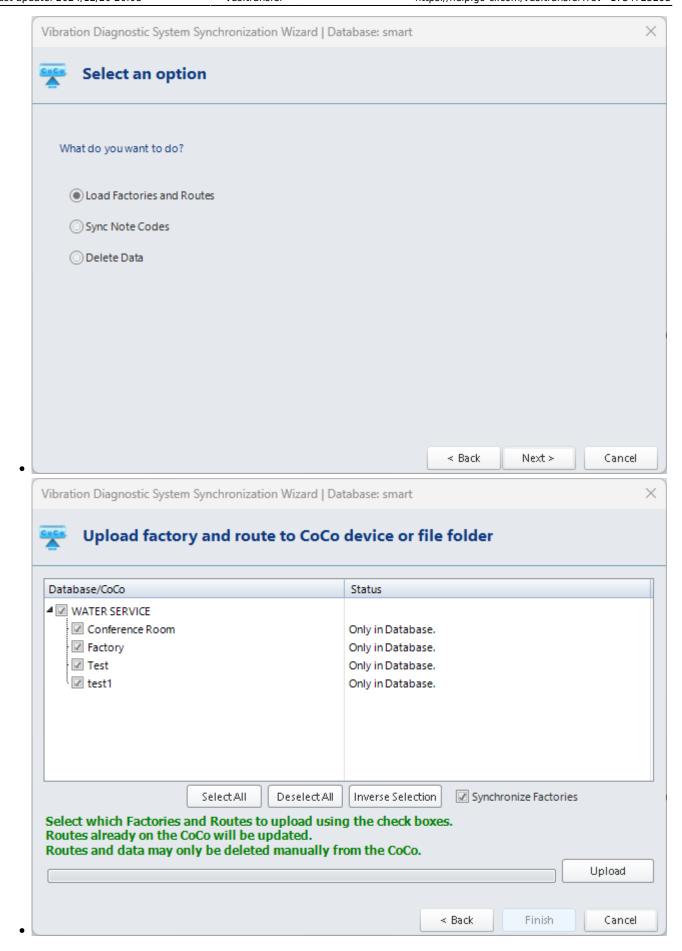
1. First Connect your CoCo device by ethernet to your PC.
2. In VDS, click **Data Collector** > in the **Devices** menu, click **Load** > Click **CoCo**

device > **Select the Device you are using** > Click Next > Click **Load Factories and Routes** > Click **Next**

3. Your VDS will have Factories and Routes to choose to upload to your CoCo device.
   Select options to upload > Click **Upload >** Click **Finish**

From:
https://help.go-ci.com/ - **Crystal Instruments Help**

Permanent link:
https://help.go-ci.com/vds:transfer?rev=1734725293

Last update: **2024/12/20 20:08**